



## Optical Fiber Mirror

### Features

Low Insertion Loss  
High Return Loss  
High Reliability & Stability

### Applications

Fiber Optics Lasers  
Fiber Sensors  
Coherent Detecting


### Specifications

Parameters	Unit	Values
Center Wavelength	nm	1064
Operating Wavelength Range	nm	±30
Typ. Insertion Loss	dB	0.4
Max. Insertion Loss	dB	0.6
Max. PDL	dB	0.05
Max. Optical Power	mW	300
Max. Tensile Load	N	5
Fiber Type		HI 1060 Fiber
Operating Temperature	°C	-5 to +70
Storage Temperature	°C	-40 to +85

\*Above specifications are for device without connector.

\*For devices with connectors, IL will be 0.3dB higher.

### Package Dimensions

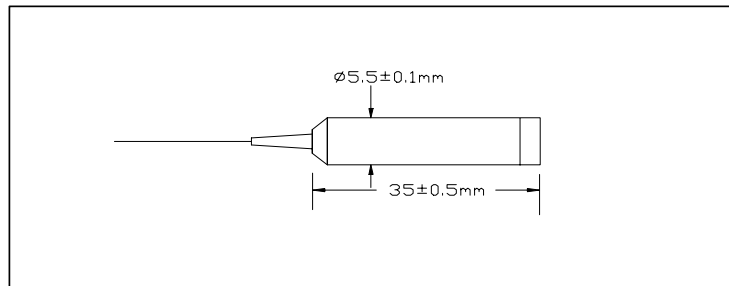

### Ordering Information

**OFM-** ①①-②-③-④

①①: Wavelength

06 - 1064nm

SS - Specify

③: Fiber Jacket

B - 250um Bare Fiber

L - 900um Loose Tube

C - 3mm Cable

S - Specify

②: Connector Type

1 - FC/UPC

2 - FC/APC

3 - SC/UPC

4 - SC/APC

N - None

S - Specify

④: Fibre Length

1 - 1.0m

S - Specify